



DIGITAL EARTH TESTER KEW 4105DL / KEW 4105DL-H



KEW 4105DL / 4105DL-H Specifications

Earth resistance measurement	20Ω	200Ω	2000Ω
Measuring range	0.00 - 2000 Ω		
Display range	0.00 - 20.99 Ω	0.0 - 209.9 Ω	0 - 2099 Ω
Accuracy*1	±1.5%rdg±0.08 Ω *2 ±1.5%rdg±4dgt		
Auxiliary earth resistance*3	<10 kΩ	<50 kΩ	<100 kΩ
Comparator reference value	10 Ω	100 Ω	500 Ω
Earth voltage measurement			
Measuring range	0.0 - 300.0 V AC (45 - 65Hz) / ±0.0 - ±300.0 V DC		
Display range	0.0 - 314.9 V		
Accuracy	±1%rdg±4dgt		
Applicable Standards	IEC 61010-1 CAT IV 100 V / CAT II 150 V / CAT II 300 V Pollution degree 3		
	IEC 61010-2-030, IEC 61010-031, IEC 61557-1, -5		
	IEC 60529 IP67, IEC 61326-1, -2-2 (EMC), EN50581 (RoHS)		
Power source	LR6 (AA)(1.5V)×6		
Dimensions	121(L)×188(W)×59(H) mm (including case lid)		
Weight	Approx. 690g (including batteries and case lid)		
Accessories for 4105DL	7267 (Cable reel for Earth resistance tester (red))		
(Cable Reel Set Model)	7268 (Cable reel for Earth resistance tester (yellow))		
	7271 (Earth resistance test leads)		
	7127B (Simplified measurement probe)		
	8041 (Auxiliary earth spikes[2 spikes / 1set]), 9121 (Shoulder strap)		
	9190 (Carrying case), LR6 (AA)×6, Instruction manual		
Accessories for 4105DL-H	DLH 7266 (Earth resistance test leads [red-20m, yellow-10m, green-5m / 1set]) 7127B (Simplified measurement probe)		
(Hard Case Model)			
	8041 (Auxiliary earth spikes[2 spikes / 1set]), 9121 (Shoulder strap)		
	9191 (Hard case), LR6 (AA)×6, Instruction manual		
Optional	7272 (Precision measurement Cord set)		
	8259 (Adapter for mea	surement terminal)	

- *1 For precision measurement, auxiliary earth resistance should be 100 Ω ±5% or less.
- $^{^{\rm 2}}$ At simplified measurement add $\pm 0.10~\Omega$ to the specified accuracy.
- $^{+3}$ Accuracy within the auxiliary earth resistance: $\pm 5\%$ rdg ± 10 dgt.


4105DL Included Accessories



4105DL-H Included Accessories



Strong noise rejection!

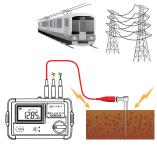

Noise rejection up to 25V rms allows accurate testing in noisy environments.

Earth voltage warning


A red LED comes on if an external voltage is detected.



[LED light comes on if:]

Frequency	Voltage	
0 – 10Hz	> 10 V	
10 – 100Hz	> 25 V	
100 – 400Hz	> 5 V	

Robust steel made earth spikes

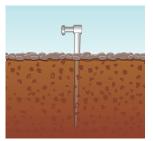

Earth measurements are possible up to 100kΩ* of auxiliary earth spikes resistance.

* 20 Ω range 10 k Ω , 200 Ω range 50 k Ω , 2000 Ω range 100 k Ω .

4105DL checks if the auxiliary earth resistance is:

Too high at S(P) terminal



Too high at H(C) terminal



Optional Accessories



7272

<MODEL 7272 precision measurement Cord set>





7268





8041





Adapters for measurement terminals



8259



Please read the "Safety Warnings" in the instruction manual supplied with the instrument thoroughly and completely Safety Warnings: If the Institution and Supplied with the Institution the Institution and Supplied with the to operate the instrument on a correct power supply and voltage rating marked on each instrument.

For inquires or orders:



KYORITSU ELECTRICAL **INSTRUMENTS** WORKS, LTD.

2-5-20, Nakane, Meguro-ku, Tokyo, 152-0031 Japan Phone:+81-3-3723-0131 Fax:+81-3-3723-0152 E-mail:info-eng@kew-ltd.co.jp

http://www.kew-ltd.co.jp

Auxiliary earth resistance check